



Service Center Inspection Form

2007 Acura TL PW040864

Complete

Score	16 / 25 (64%)	Flagged items	0	Actions	0
VEHICLE	2007 Acura TL PW040864				
MILEAGE	143516				
Prepared by	2007 Acura TL PW040864				
Vehicle Stock #	2007 Acura TL PW040864				

Inspection

16 / 25 (64%)

INTERIOR / EXTERIOR

4 / 6 (66.67%)

1. Lights, Horn, and Lenses

Good



Photo 1

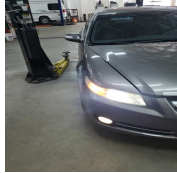


Photo 2

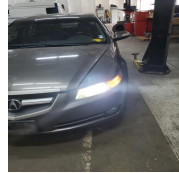


Photo 3

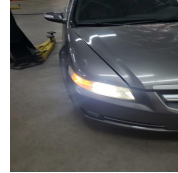


Photo 4



Photo 5

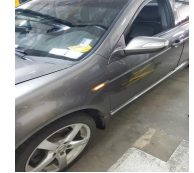


Photo 6

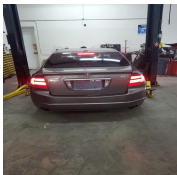


Photo 7



Photo 8

2. Wiper Blade Operation

Good

3. Cabin Air Filter

clogged. severely limits airflow. rec replacement



Photo 9

4. Parking Brake Operation

Good

5. A/C Operation

Good

Poor airflow, see: Cabin air filter



Photo 10

6. Interior Switches

Drivers seat heater inop. confirmed power and ground to seat connector. rec replacement of drivers seat

FLUIDS

2 / 4 (50%)

6. Engine Oil

✓

7. Coolant

Low. topped off. See: Radiator

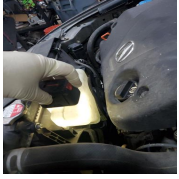


Photo 11

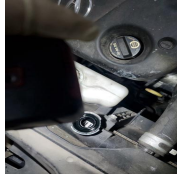


Photo 12

8. Transmission Fluid

Good

slightly dirty, no offensive odor.

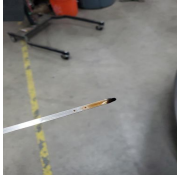


Photo 13

9. Power Steering Fluid

Low, topped off with honda PSF. no leaks found.



Photo 14

10. Brake System Fluid (visual check)

Good

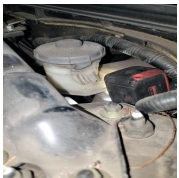


Photo 15

11. Front Differential

N/A

Internal to transmission

12. Rear Differential

N/A

FWD

13. Transfer Case

N/A

FWD

UNDER HOOD

5 / 7 (71.43%)

14. Radiator

coolant staining found around coolant bottle and surrounding areas. cap to coolant bottle is split. removed

radiator cap to find a portion of it missing, causing there to be no seal on cooling system, when car gets warm, it pushes coolant into overflow bottle which then pushes excess coolant out of the bottle onto surrounding area.

rec replacement of radiator cap and coolant overflow bottle cap.



Photo 16



Photo 17

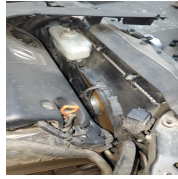


Photo 18



Photo 19

15. Drive Belts

Good

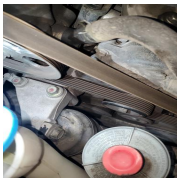


Photo 20

16. Hoses (coolant & power steering)

Good

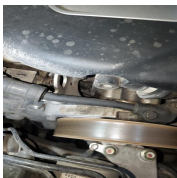


Photo 21

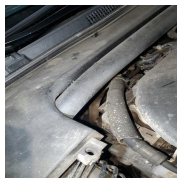


Photo 22

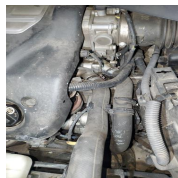


Photo 23

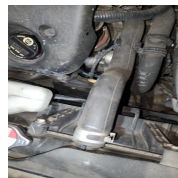


Photo 24

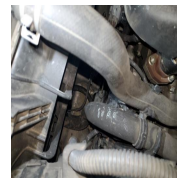


Photo 25

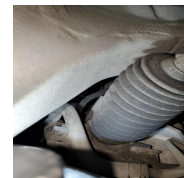


Photo 26

17. Brake System

Good

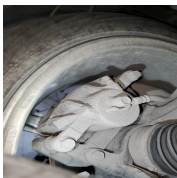


Photo 27



Photo 28



Photo 29

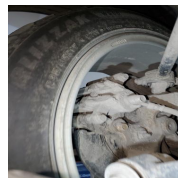


Photo 30

18. Fuel Filter

N/A

internal to fuel tank

19. Water Pump

N/A

driven by timing belt. looked for signs of leakage on weep area of block, none found.

20. Battery (voltage test)

Good

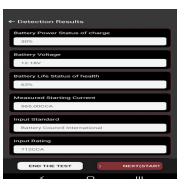


Photo 31

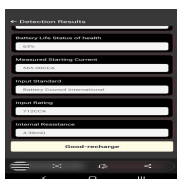


Photo 32

21. Battery Cables

Good



Photo 33



Photo 34

22. Engine Air Filter

very dirty. rec replacement



Photo 35

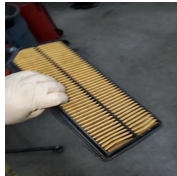


Photo 36

UNDERCARRIAGE

4 / 7 (57.14%)

23. Steering Linkage & Gear

LF Lower control arm forward bushing is broken/torn. rec replacement of LF Lower control arm



Photo 37

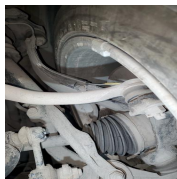


Photo 38

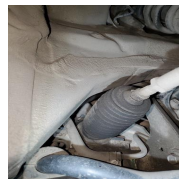


Photo 39

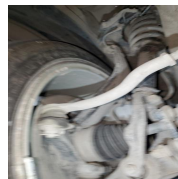


Photo 40



Photo 41

24. Struts/Shocks

Good

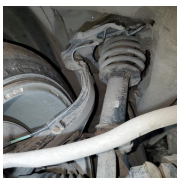


Photo 42



Photo 43

25. C/V Boots, Shafts, and Seals

Good

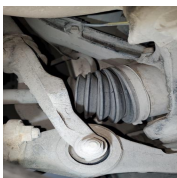


Photo 44

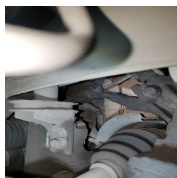


Photo 45

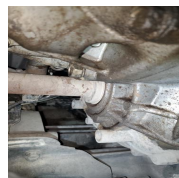


Photo 46



Photo 47



Photo 48

26. Oil Leaks

there are signs that vehicle has oil pump seal leak, and oil pan leak. Leaks are not actively dripping at this time.

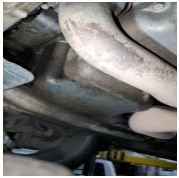


Photo 49



Photo 50



Photo 51



Photo 52



Photo 53

27. Transmission Fluid Leaks

there are signs of transmission leak from the case seams. not actively dripping at this time.



Photo 54



Photo 55

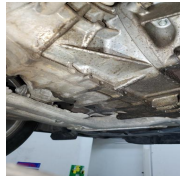


Photo 56

28. Exhaust System

Good

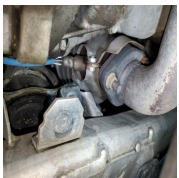


Photo 57

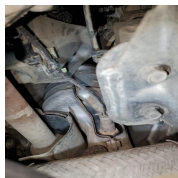


Photo 58

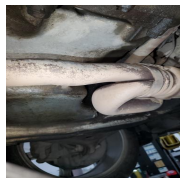


Photo 59

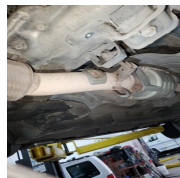


Photo 60

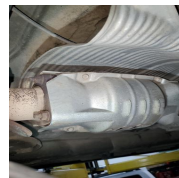


Photo 61

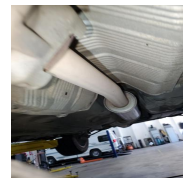


Photo 62



Photo 63



Photo 64

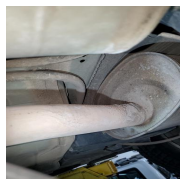


Photo 65

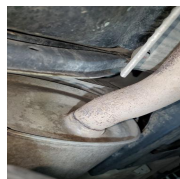


Photo 66

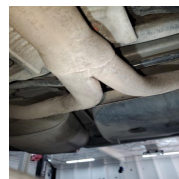


Photo 67



Photo 68

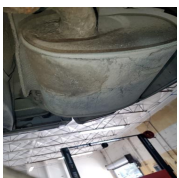


Photo 69

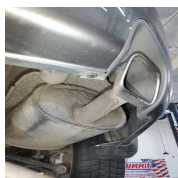


Photo 70



Photo 71

29. Rear Struts / Shocks

Good

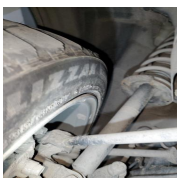


Photo 72



Photo 73

BRAKE MEASUREMENT

LEFT FRONT

5



Photo 74

RIGHT FRONT

6

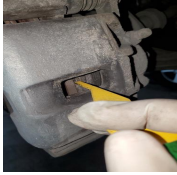


Photo 75

LEFT REAR

3

rec rear pads and rotors



Photo 76

RIGHT REAR

3



Photo 77

TIRE MEASUREMENT

LEFT FRONT

2

235-45-17



Photo 78



Photo 79

RIGHT FRONT

2

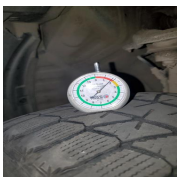


Photo 80

LEFT REAR

6



Photo 81

RIGHT REAR

4



Photo 82

FRAME

1 / 1 (100%)

Good



Photo 83



Photo 84

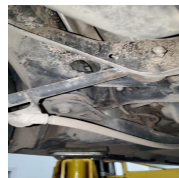


Photo 85

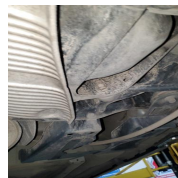


Photo 86

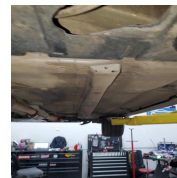


Photo 87

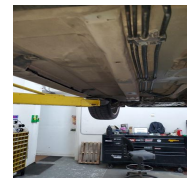


Photo 88



Photo 89



Photo 90

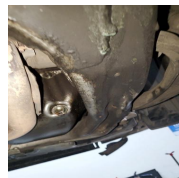


Photo 91

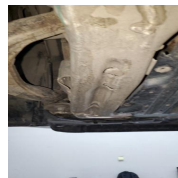


Photo 92

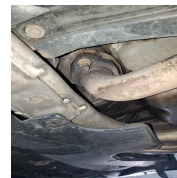


Photo 93

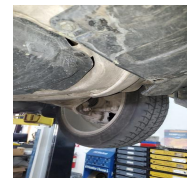


Photo 94

ADDITIONAL NOTES

Drivers visor is loose and will flop around.

drivers vanity mirror will not sit flush in visor.

vehicle had several codes stored in a large portions of the modules. cleared codes and checked for returns. only 2 codes to return were for drivers air mix (temp) door actuator. looked under dash and confirmed that actuator is moving, and that air temp changes through the vents. suspect error condition is on the position sensor side of actuator. Rec replacement of actuator

rec replacement of rear pads and rotors.

Confirmed vehicle has run and passed all relevant monitors before clearing codes.

engine nose mount (from front of engine, to right front frame rail) is blown out, allowing engine to move around under load. rec replacement.



Photo 95



Photo 96



Photo 97

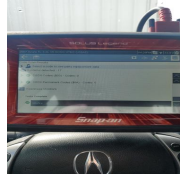


Photo 98

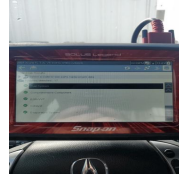


Photo 99

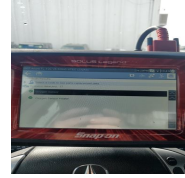


Photo 100

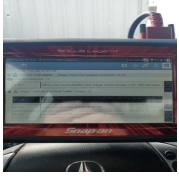


Photo 101

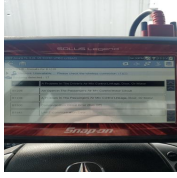


Photo 102

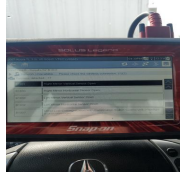


Photo 103

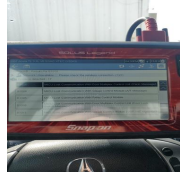


Photo 104

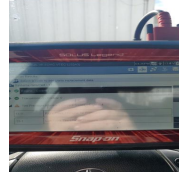


Photo 105

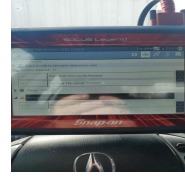


Photo 106

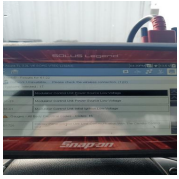


Photo 107

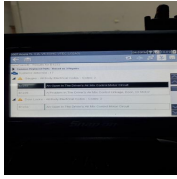


Photo 108

[76c77f50-056c-454b-bb83-6fa7bda3fd29.mp4](#)

Media summary



Photo 1

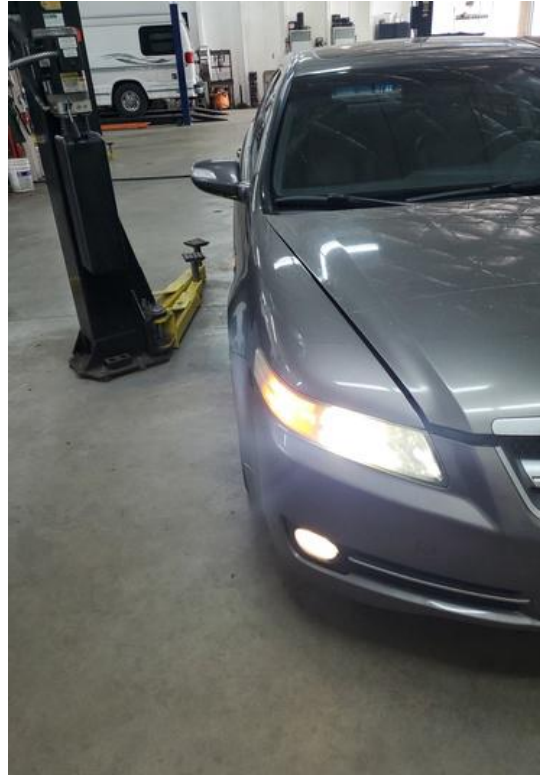


Photo 2



Photo 3



Photo 4



Photo 5



Photo 6

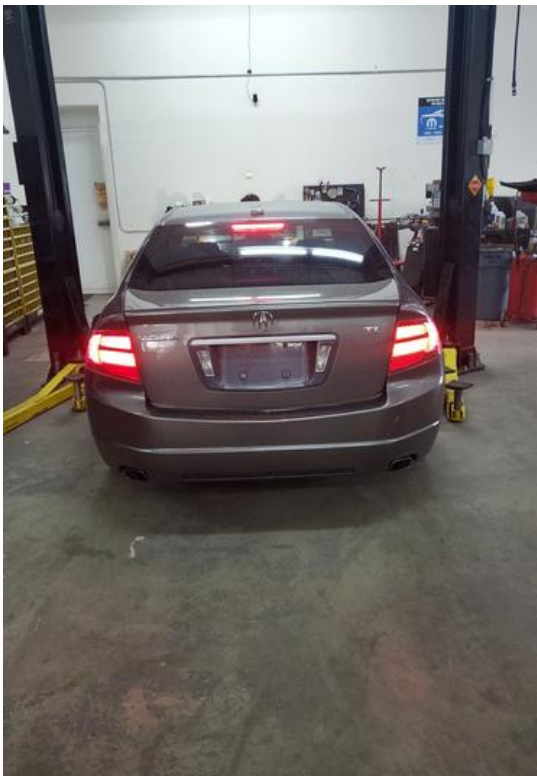


Photo 7

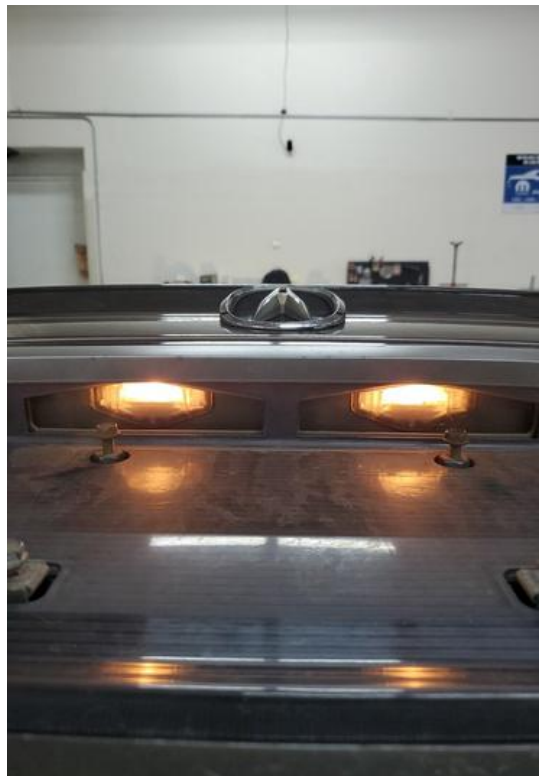


Photo 8



Photo 9

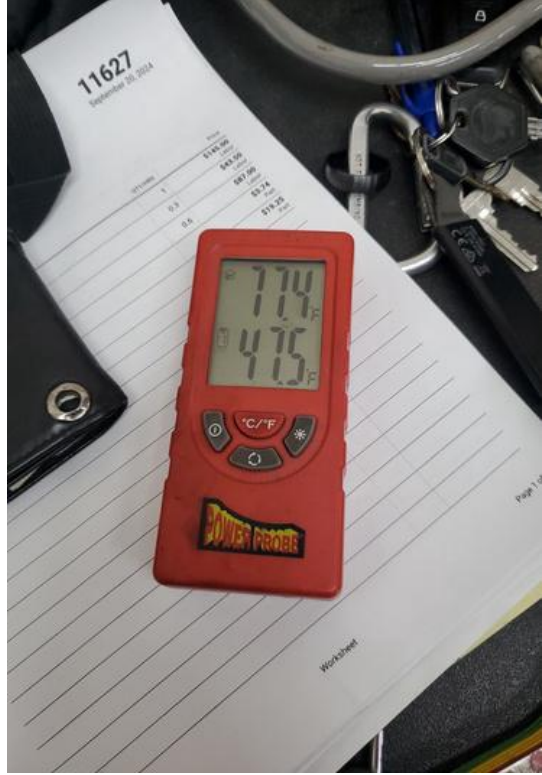


Photo 10



Photo 11

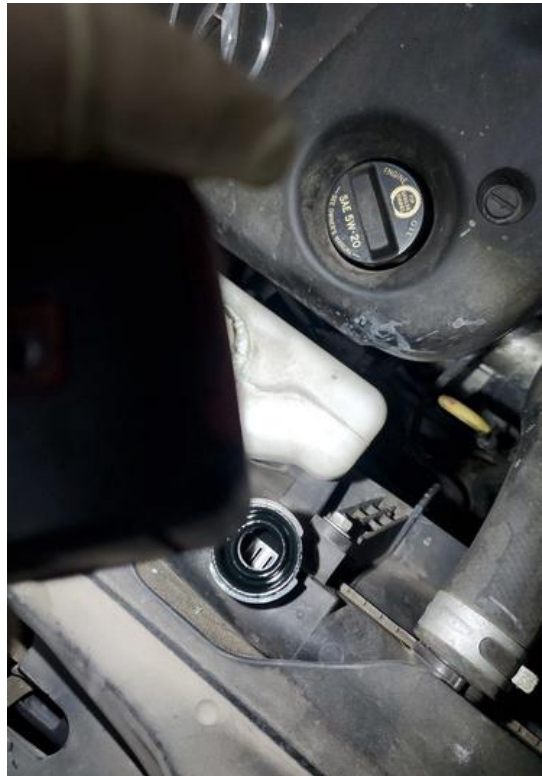


Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20



Photo 21

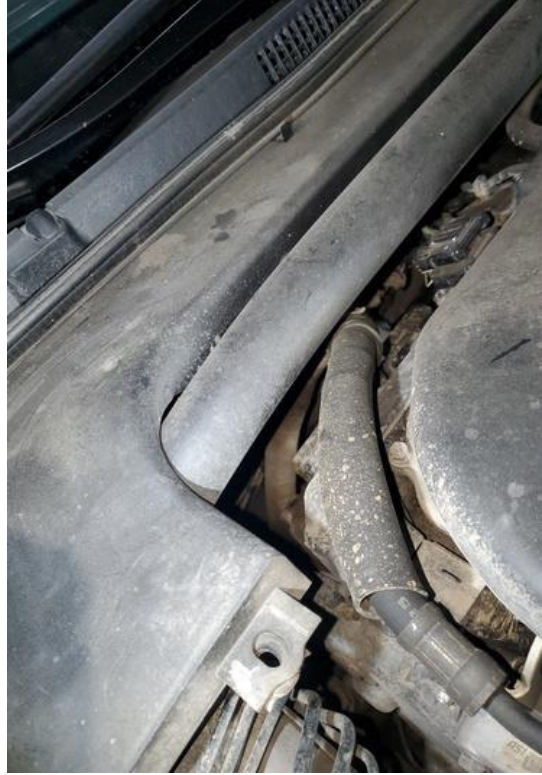


Photo 22



Photo 23



Photo 24



Photo 25



Photo 26



Photo 27



Photo 28



Photo 29



Photo 30

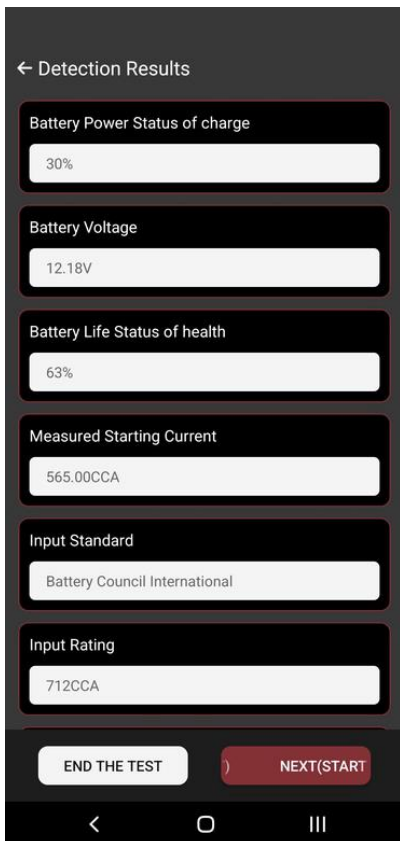


Photo 31

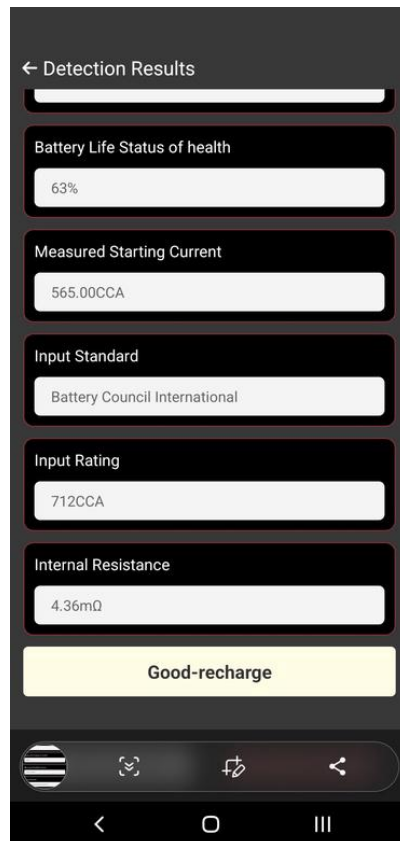


Photo 32



Photo 33



Photo 34



Photo 35



Photo 36



Photo 37



Photo 38



Photo 39

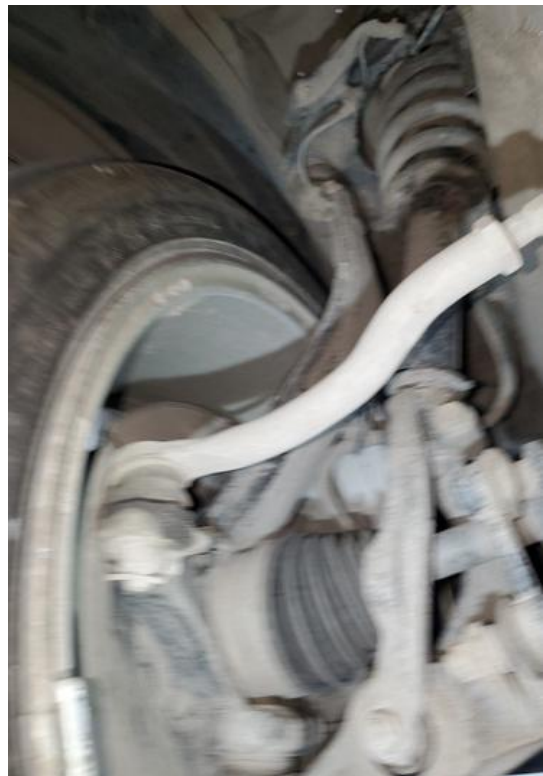


Photo 40



Photo 41



Photo 42



Photo 43



Photo 44



Photo 45



Photo 46



Photo 47



Photo 48

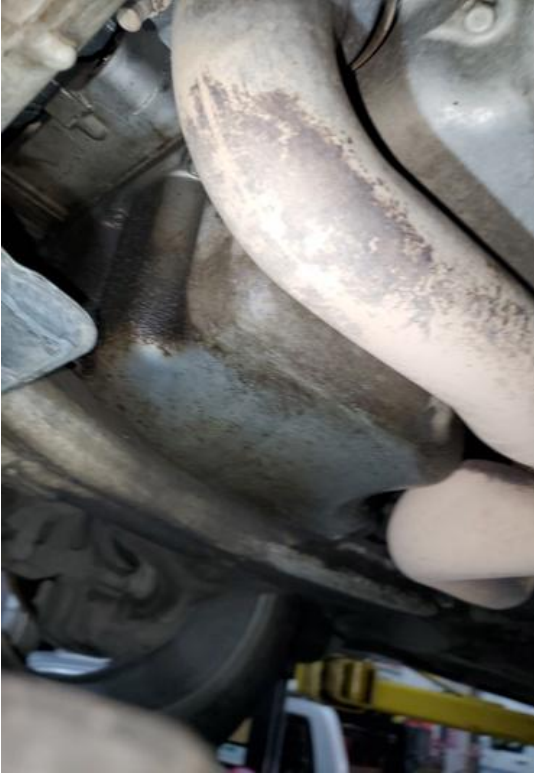


Photo 49

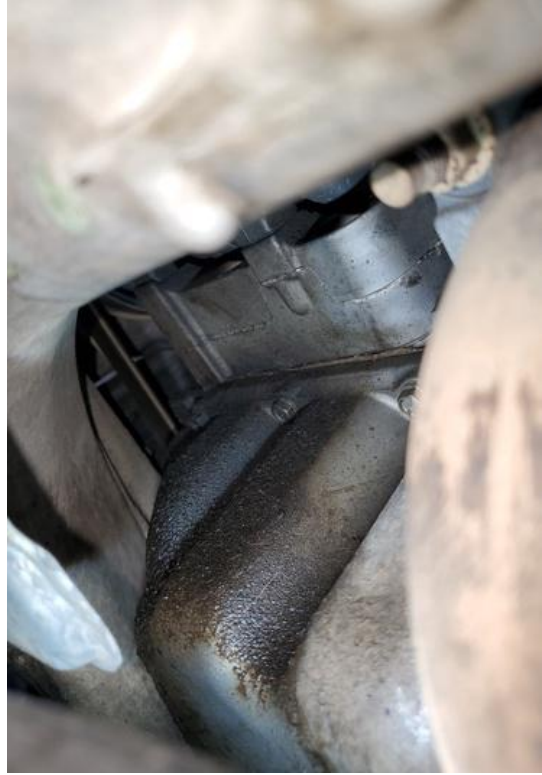


Photo 50



Photo 51



Photo 52



Photo 53



Photo 54



Photo 55

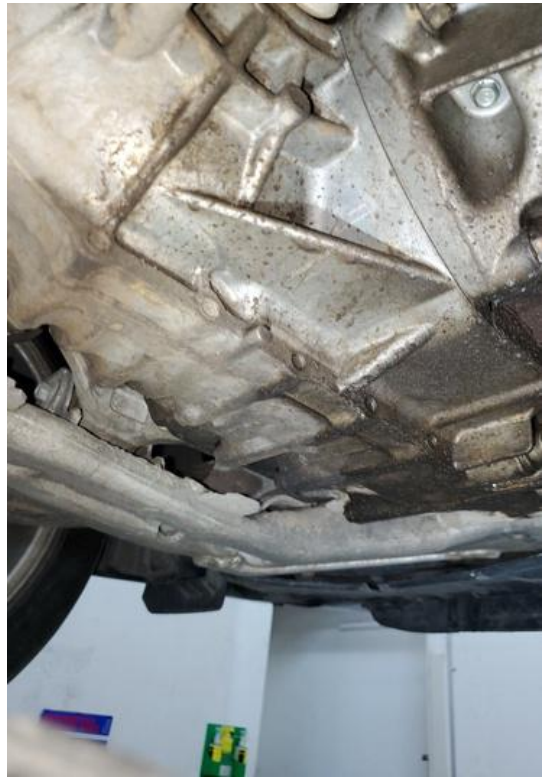


Photo 56



Photo 57

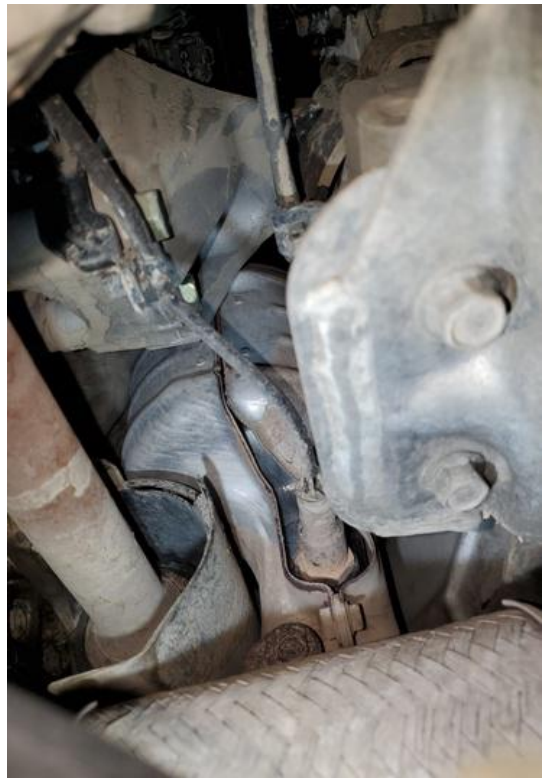


Photo 58



Photo 59

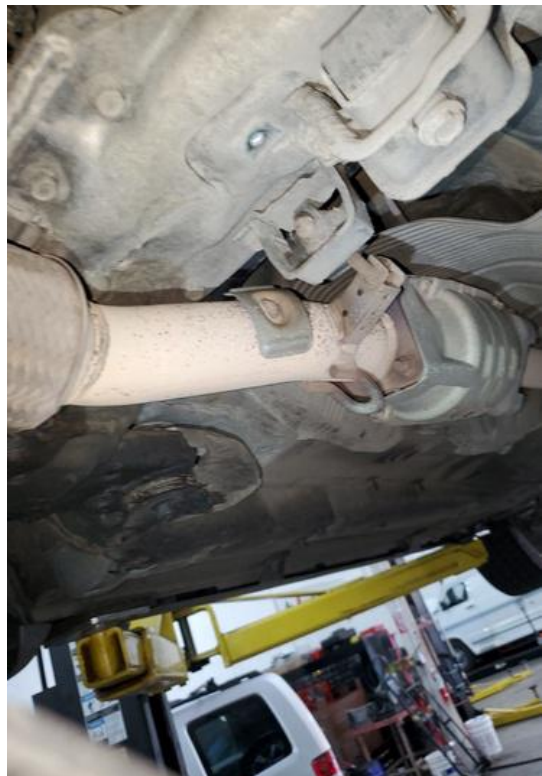


Photo 60



Photo 61



Photo 62



Photo 63



Photo 64



Photo 65



Photo 66

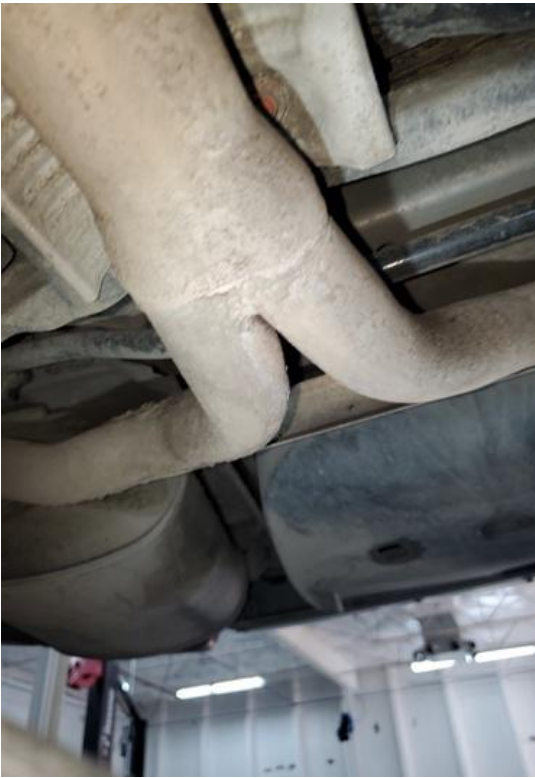


Photo 67



Photo 68



Photo 69



Photo 70



Photo 71



Photo 72



Photo 73



Photo 74



Photo 75



Photo 76



Photo 77



Photo 78



Photo 79



Photo 80



Photo 81



Photo 82



Photo 83



Photo 84



Photo 85



Photo 86



Photo 87



Photo 88



Photo 89



Photo 90



Photo 91



Photo 92



Photo 93



Photo 94



Photo 95



Photo 96



Photo 97

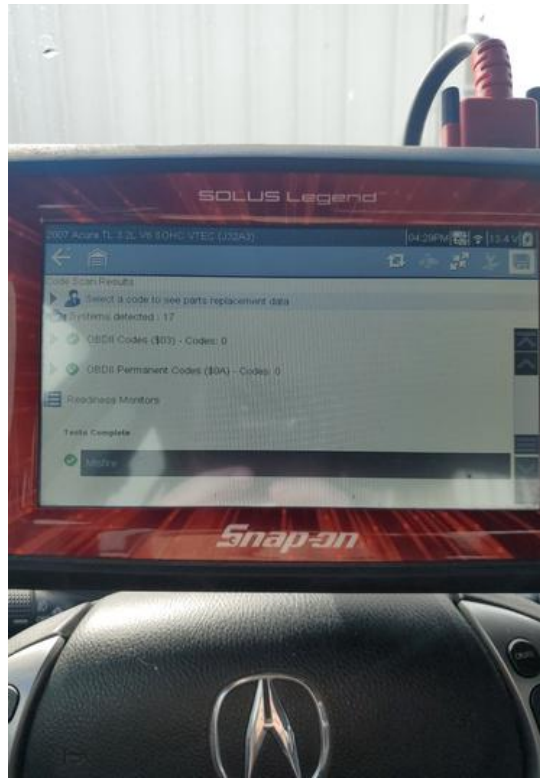


Photo 98

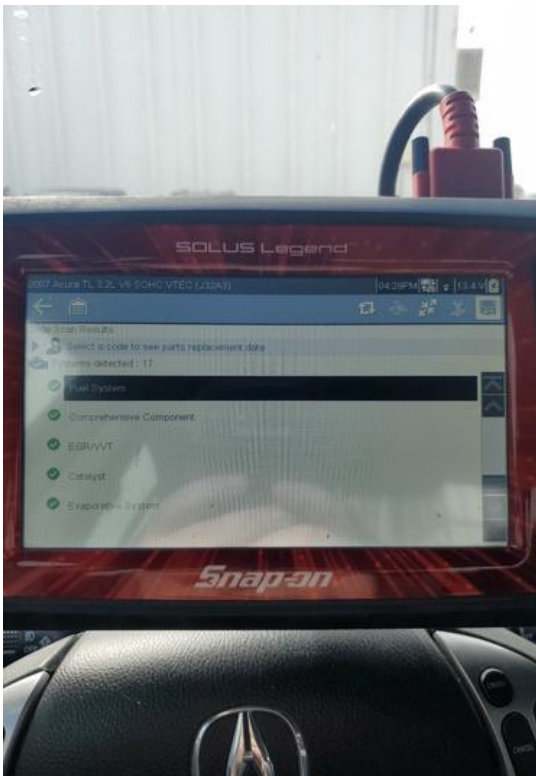


Photo 99

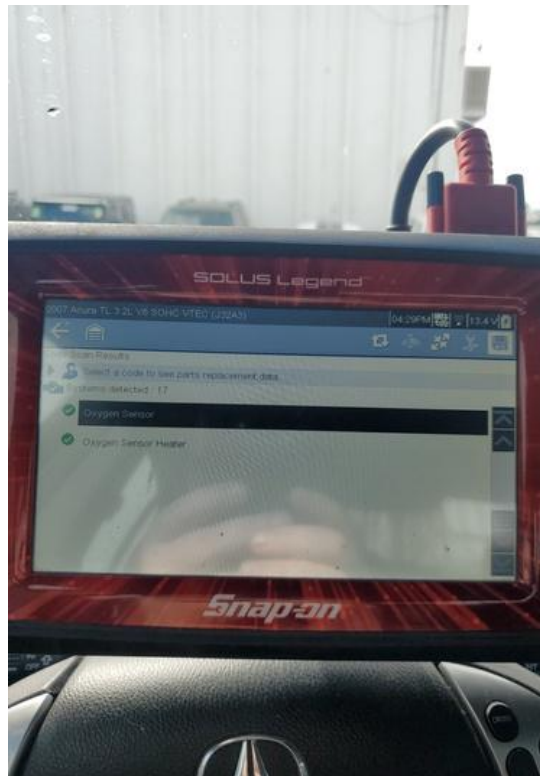


Photo 100

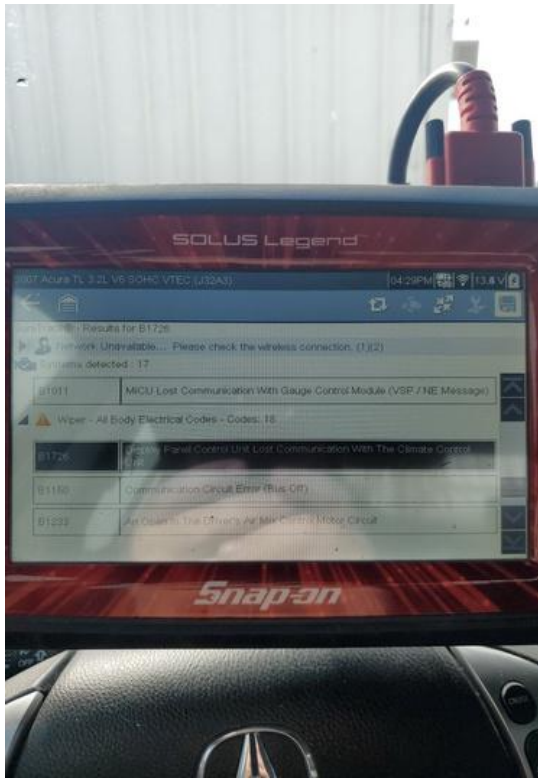


Photo 101

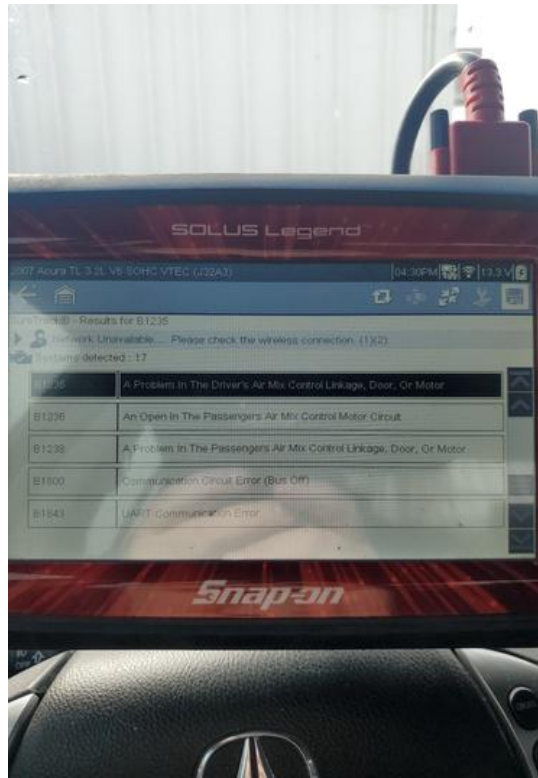


Photo 102

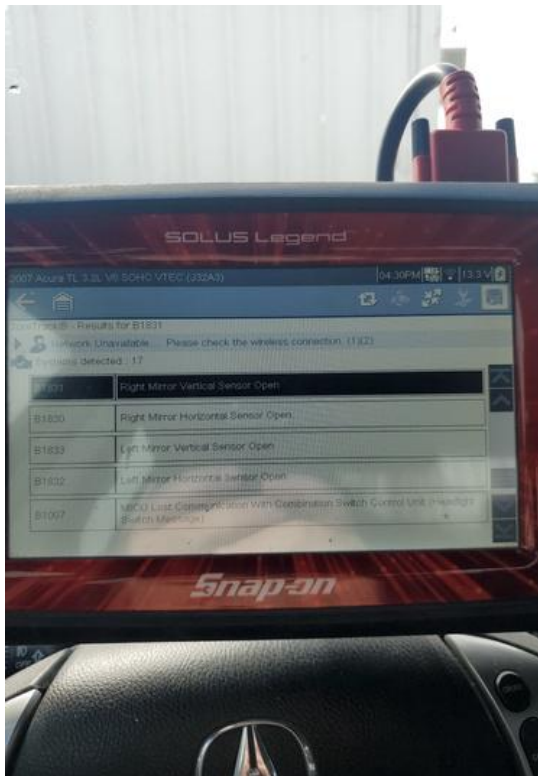


Photo 103

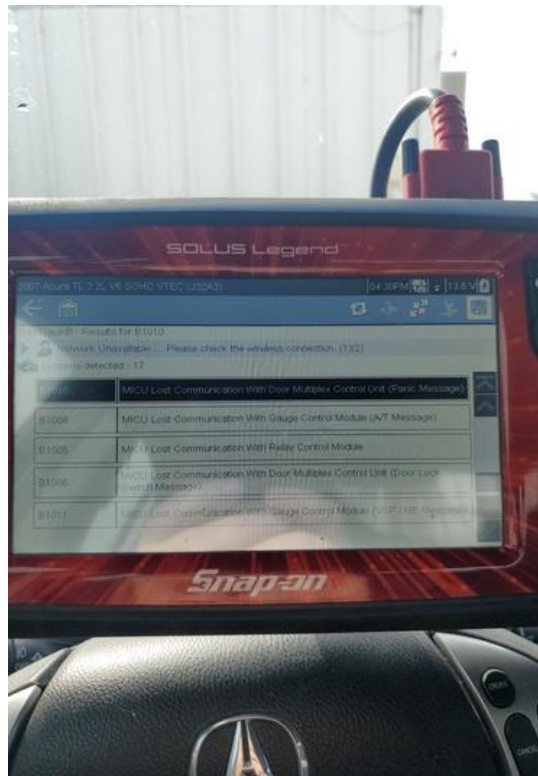


Photo 104

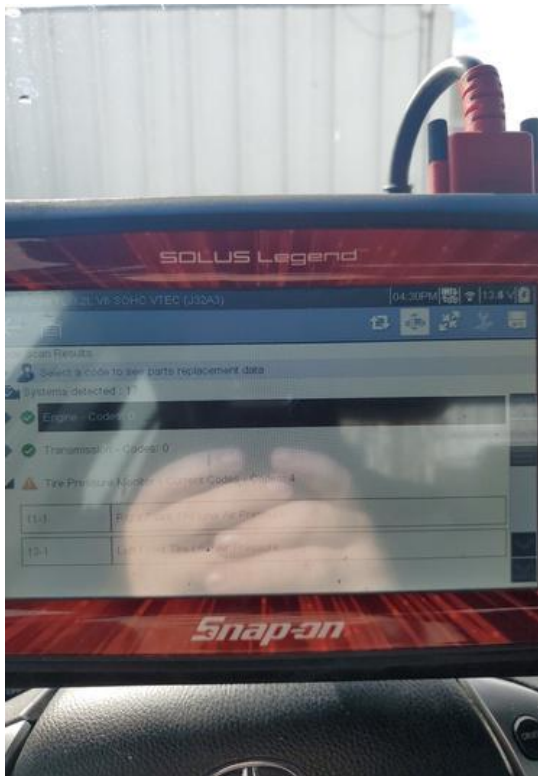


Photo 105

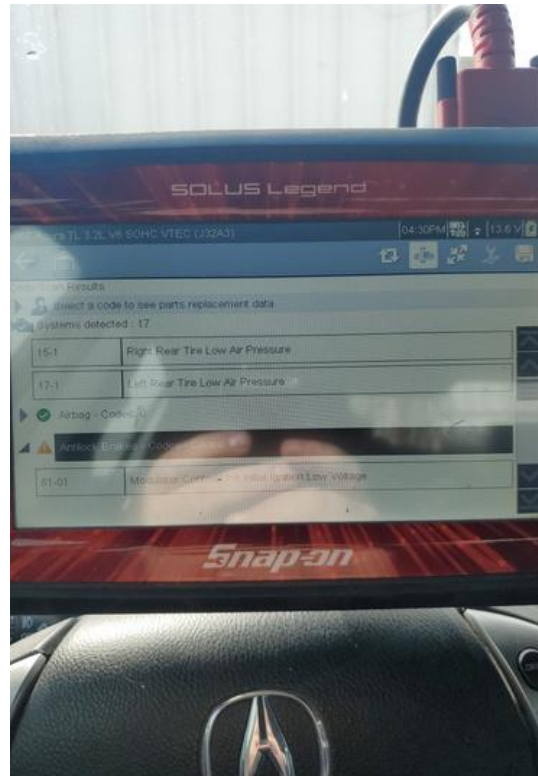


Photo 106

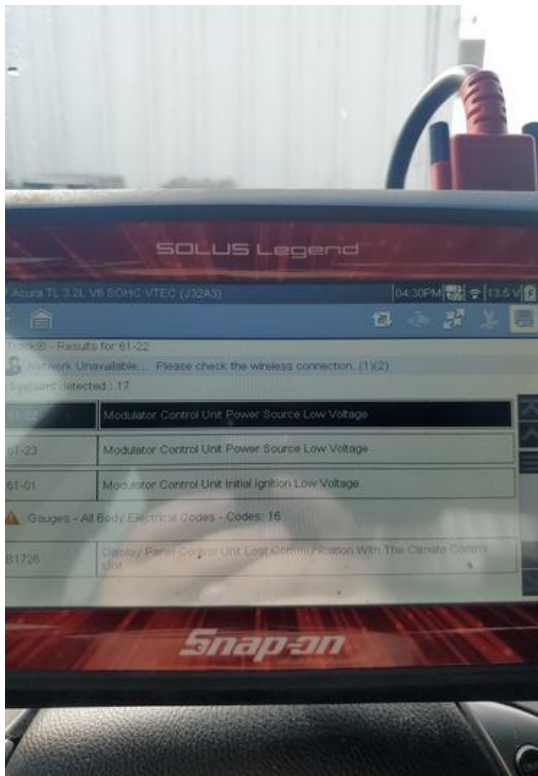


Photo 107

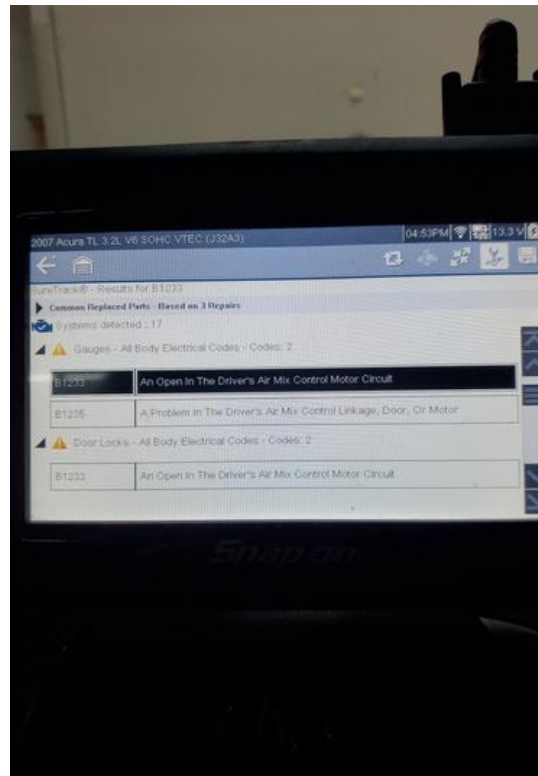


Photo 108

File summary

[76c77f50-056c-454b-bb83-6fa7bda3fd29.mp4](#)



Invoice
11870
October 15, 2024

2007 Acura TL AT

AT
Gray

STK: PW040864
VIN: 19UUA66237A040864

Miles
143345

Internal
STK: PW040864

Name	QTY/HRS	Price
1 Technician Labor		
1. CHECK FOR OIL LEAKS? THE TECHNICIAN FOUND THAT THE VALVE COVER GASKET AND TIMING COVER WAS SEEPING. HE TORQUED ALL OF THE VALVE COVER AND TIMING COVER BOLTS TO MANUFACTURE SPECIFICATIONS. HE STEAM CLEANED THE COMPLETE ENGINE AND UNDERCARRIAGE. AFTER STEAM CLEANING HE CHECKED THE VEHICLE AND FOUND NO OTHER SEEPAGE AT THIS TIME.	2	\$290.00 Labor

Any warranty on the item(s) sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability. Buyer shall not be entitled to recover from the selling dealer any consequential damages, damages to property, damages for loss of use, loss of time, loss of profits or income, or any other incidental damages.

No parts or labor warranty when used parts are installed.

Parts	\$0.00
Labor	\$290.00
Sales Tax (0%)	\$0.00
Shop Supply (10%)	\$29.00

Total **\$319.00**
Balance **\$319.00**

Stock# PW040864

2007 Acura TL


Multi-Point Used Vehicle Safety and Mechanical Inspection

This vehicle has been inspected by an ASE Certified Technician. The items below were inspected and found to be operational/acceptable or repaired to that level.



Interior & Optional Equipment Inspection

- Instrument Panel- Cluster and Gages
- Safety Equipment – Horn, Signals, Lights, Restraints, air Bags, Mirrors, and Defrost
- Optional Power Equipment – Power Windows, Seats, Locks, Doors, Lift Gate, Sunroof, Mirrors, And Outlets
- Audio/Video Equipment – Stereo, CD, Navigation, DVD and Backup Camera

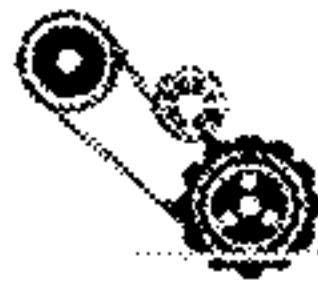

Under the Hood Inspection

- Engine – Visual Inspection, Audible Noise, Power, Performance, and Turbo/Supercharger Boost (where applicable)
- Ignition System – Starter, Plugs, Wires, Connections, Battery, and Cables
- Cooling System – Radiator, Water Pump and Thermostat.
- Fuel System – Injectors, Fuel Lines, Rails, Tank, and Gas Cap
- Climate Control System – A/C Compressor, Condenser, Evaporator and Refrigerant



Under Vehicle Inspection

- Exhaust System – Manifold(s), Gaskets, Pipes, Hangers, Mufflers, and Catalytic Converter(s).
- Steering & Suspension System – Power Steering Pump, CV Axles, Tie Rod Ends, Sway Bars, Wheel Bearings, Shocks & Struts, and Control Arm Bushings.



Drivability Inspection

- Engine – Idle, Acceleration, Turbo/Supercharger Boost (where applicable)
- Transmission - Shift Quality, Smoothly Functioning
- Alignment – Tracking correctly
- Wheel Balance – Wheels/Tires in Balance
- Brakes – Noise and/or Pulsating
- AWD/4WD – Functioning Properly

SERVICE FACILITY

AMS

SIGNED

[Signature]

DATE

10/07/2024



Seals, Gaskets and Fluid Reservoir Leak Inspection

- Engine Seals & Gaskets
- Transmission Seals & Gaskets
- Drivetrain Seals & Gaskets
- No leaks greater than Class 3 (will not leave a drip)



Warning System Inspection

- Check Engine Light
- Air Bag Light (SRS)
- Anti-Lock Brake Light (ABS)
- Tire Pressure Monitoring (TPMS)
- Maintenance Light - Reset



Brake, Tires, Lights & Signals Inspection

- Brakes- Master Cylinder, Calipers and Wheel Cylinders
- Pads/Shoes – Minimum Specifications > 4MM / > 2MM (Shoes)
- Exterior Lights & Lenses – Headlights, Taillights, Turn Signals, Brake Lights, Reverse Lights, and License Plate Lights
- Brakes – RF 6 LF 5 RR New LR New
- Tires – RF New LF New RR New LR New



Fluid and Maintenance Items Inspection

- Fluids- Engine Oil, Coolant, Brake Fluid, Transmission Fluid, Power Steering Fluid and Washer Fluid



Wear Items Inspection

- Wear Items- Belts, Hoses, Wiper Blades, Battery, Struts, Shocks, Ball Joints, Tie Rod Ends, Clutch Wear, Control Arm and/or Bushings, Muffler, Catalytic Converter(s), & all Sensors



Frame/Sub-Frame Inspection

- Visible inspection for structural damage



AutoTrek
 8297 Southpark Cir
 Littleton, CO 80120-5666
 (303) 934-5600
 sales@autotrek.com
 Dealer # 8766

Invoice
11627
 October 7, 2024

2007 Acura TL
 STK: PW040864
 VIN: 19UUA66237A040864
Miles
 143345

Internal
 STK: PW040864

Name	QTY/HRS	Price
LC \$0.00 - VEHICLE INSPECTION	1	\$0.00 Labor
LC \$125.00 - OIL CHANGE	0.3	\$37.50 Labor
LC \$125.00 - MOUNT AND BALANCE 4 TIRES	0.6	\$75.00 Labor
LC \$125.00 - REPLACE CABIN AIR FILTER	0.2	\$25.00 Labor
LC \$125.00 - REPLACE AIR FILTER	0.2	\$25.00 Labor
LC \$125.00 - REPLACE LEFT FRONT LOWER CONTROL ARM	1.1	\$137.50 Labor
LC \$125.00 - REPLACE REAR BRAKE PADS AND ROTORS	1.2	\$150.00 Labor
LC \$125.00 - REPLACE DRIVER SIDE SUN VISOR	0.2	\$25.00 Labor
LC \$125.00 - REPLACE TEMPERATURE DOOR ACTUATOR	0.8	\$100.00 Labor
LC \$125.00 - REPLACE FRONT ENGINE MOUNT	2	\$250.00 Labor
MGL57356 OIL FILTER	1	\$3.74 Part
5W20 SYNTHETIC OIL	4.5	\$19.25 Part
235/45R17 TIRES ADVANTA ER-800	4	\$357.34 Part
SFI 224815 CABIN AIR FILTER	1	\$11.33 Part
THM 7031727 RADIATOR CAP	1	\$11.54 Part
MCS 7135 COOLANT RESERVOIR CAP	1	\$16.05 Part

Parts \$1,383.76
 Labor \$825.00
 Sales Tax (0%) \$0.00
 Shop Supply (10%) \$40.00

Total \$2,248.76
Balance \$2,248.76

Name	QTY/HRS	Price
ATM 3602967 AIR FILTER	1	\$14.76 Part
LOWER CONTROL ARM KIT LOWER CONTROL ARM KIT	1	\$109.99 Part
REAR BRAKE PAD AND ROTOR KIT REAR BRAKE PAD AND ROTOR KIT	1	\$124.99 Part
USED SUN VISOR USED SUN VISOR	1	\$45.96 Part
79166SEPA02 TEMPERATURE DOOR ACTUATOR	1	\$510.65 Part
BK 6022842 ENGINE MOUNT	1	\$158.16 Part

Any warranty on the item(s) sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability. Buyer shall not be entitled to recover from the selling dealer any consequential damages, damages to property, damages for loss of use, loss of time, loss of profits or income, or any other incidental damages.

No parts or labor warranty when used parts are installed.

Parts	\$1,383.76
Labor	\$825.00
Sales Tax (0%)	\$0.00
Shop Supply (10%)	\$40.00

Total	\$2,248.76
Balance	\$2,248.76